High-Reliability and High-Performance Compact Machining Center

FANUC ROBODRILL

CO-DIB Plus series

Standard version / Advanced version



Алматы (7273)495-231 Ангарск (3955)60-70-56 Архангельск (8182)63-90-72 Астрахань (8512)99-46-04 Барнаул (3852)73-04-60 Белгород (4722)40-23-64 Благовещенск (4162)22-76-07 Брянск (4832)59-03-52 Владикавказ (8672)28-90-48 Владикавказ (8672)28-90-48 Владикарказ (8672)28-90-48 Волоград (844)278-03-48 Волоград (8172)26-41-59 Воронеж (473)204-51-73 Екатеринбург (343)384-55-89 Иваново (4932)77-34-06 Ижевск (3412)26-03-58 Иркутск (395)279-98-46 Казань (843)206-01-48 Калининград (4012)72-03-81 Калуга (4842)92-23-67 Кемерово (3842)65-04-62 Киров (8332)68-02-04 Коломна (4966)23-41-49 Кострома (4942)77-07-48 Краснодар (861)203-40-90 Краснордск (391)204-63-61 Курск (4712)77-13-04 Курган (3522)50-90-47 Липецк (4742)52-20-81

Россия +7(495)268-04-70

Магнитогорск (3519)55-03-13 Москва (495)268-04-70 Мурманск (8152)59-64-93 Набережные Челны (8552)20-53-41 Нижний Новгород (831)429-08-12 Новокузнецк (3843)20-46-81 Ноябрьск (3496)41-32-12 Новосибирск (383)227-86-73 Омск (3812)21-46-40 Орел (4862)44-53-42 Оренбург (3532)37-68-04 Пенза (8412)22-31-16 Петрозаводск (8142)55-98-37 Псков (8112)59-10-37 Пермы (342)205-81-47 Казахстан +7(7172)727-132 Ростов-на-Дону (863)308-18-15 Рязань (4912)46-61-64 Самара (846)206-03-16 Санкт-Петербург (812)309-46-40 Саратов (845)249-38-78 Севастополь (8692)22-31-93 Саранск (8342)22-96-24 Симферополь (3652)67-13-56 Смоленск (4812)29-41-54 Сочи (862)225-72-31 Ставрополь (8652)20-65-13 Сургут (3462)77-98-35 Сыктывкар (8212)25-95-17 Тамбов (4752)50-40-97 Тверь (4822)63-31-35 Киргизия +996(312)96-26-47 Тольятти (8482)63-91-07 Томск (3822)98-41-53 Тула (4872)33-79-87 Тюмень (3452)66-21-18 Ульяновск (8422)24-23-59 Улан-Удэ (3012)59-97-51 Уфа (347)229-48-12 Хабаровск (4212)92-98-04 Чебоксары (8352)28-53-07 Челябинск (351)20-20-61 Череповец (8202)49-02-64 Чита (3022)38-34-83 Якутск (4112)23-90-97 Ярославль (4852)69-52-93

High-Reliability and High-Performance Compact Machining Center

FANUC ROBODRILL &-DiB Plus



 $^{\circ}$ -D14/21LiB Plus $^{\circ}$ -D14/21/28LiBad Plus Y500

X-axis stroke: 700 mm



X-axis stroke: 500 mm



C-D14/21Si Plus C-D14/21Si Badv Plus

X-axis stroke: 300 mm

^{* 1} Photo when **DDR** i B mounted

^{*2} Photo when front double doors option mounted

series

High-Performance of Machining

High-speed, high-precision and fine surface machining by high-rigidity machine structure and latest CNC functions

Utilization in various fields by wide variety of spindle

High-productivity by stable machining with thermal displacement compensation function

Maximizing Uptime

Long-term stable operation by high-reliability, high-maintainability and preventive maintenance functions

Reducing power consumption including peripherals by energy saving technologies Operation condition monitoring and analysis by **ROBODRILL-LINK** i

Ease of Use

Excellent operability of exclusive screens with human-centered design

Easy to connect peripherals or network by high-expandability and user-interface

Easy integration with FANUC Robot by automation supporting functions













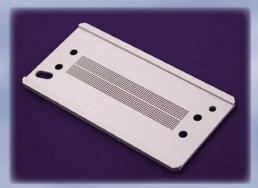

Features of @-DiB Pus series Advanced version

New product @-D28LiBADV Plus Y500

- Y-axis stroke 500mm
- Stroke extension by 100mm to meet the needs of combined and large-sized parts machining
- Table depth also extended to 500mm to accept larger fixture
- Machine length extension only by 65mm by applying multi-steps telescopic cover, etc.
- · Approach from front door to table only 180mm
- Tool storage capacity 28 tools *
- · Large-sized turret to enhance process integration
- · Max. tool mass 4kg, Max. total tool mass 46kg
- · Tool change time 0.7s (1.5kg setting, Tool to Tool)
 - * Option for X-axis stroke 500mm and 700mm of Advanced version
- Level-up of Z-axis feed
 - Rapid traverse rate 60m/min, Max. acceleration 2.2G
 - · Cycle time reduction in drilling and tapping
- DDR-TLi raised version (option)
- Max. turn diameter 540mm to make the most of Y-axis stroke 500mm

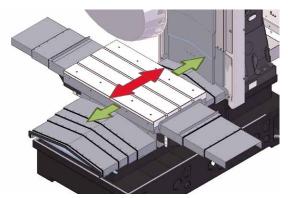

Extension of Y-direction stroke and table size




Large-sized turret for 28 tools



C-D28LiBADV Plus Y500

Expanding application range


- Expanding machining area
 - · Z-axis stroke extension to 400mm improves approach to the machining point
 - Less interference structure with the large fixture
- Table load capacity 400kg *
- Applicable to large fixture and workpiece
 - * Max 200kg for X-axis stroke 300mm
- High column (option) *
- · Column raising up to 400mm depending on fixture is available for wide range of application
 - * Max 200mm for X-axis stroke 300mm
- Servo turret
- · Max. tool weight 4kg enables larger cutting tool
- · Tool change time reduction by 0.2s compared with standard version ROBODRILL

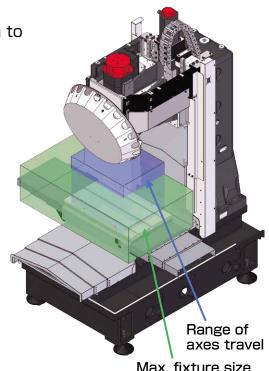


Max. fixture size

Excellent chip countermeasure

- Z-axis telescopic cover
 - · Higher durability by newly applying telescopic cover
- · Compact design for less interference
- Y-axis front mountain-shaped telescopic cover *
- · Smooth coolant flow improves chip evacuation
- Enhanced covering against chips and coolant
 - * Applied except for X-axis stroke 300mm
- X-axis telescopic cover with 3 pieces *
 - · 3 pieces cover is applied as standard
 - Higher reliability by the improvement of structure
 - * Applied except for X-axis stroke 300mm

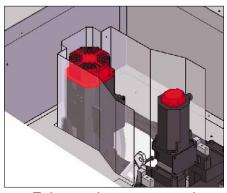

Enhanced cover around spindle motor

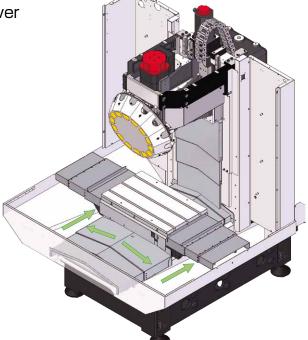

Telescopic covers are applied on all axes

- Enhanced cover around spindle motor (option) *
- · Certain separation of spindle mechanism from machining area protects intrusion of chips and coolant and achieves high-sustainability

^{*} Basic top cover (option) is necessary


Features of C-DiB Pus series

Cycle time reduction technologies to achieve high-productivity

- Machining mode setting function 2
- New machining modes with latest CNC functions realize further cycle time reduction, high-precision machining and fine surface machining
- Intuitive and operable screen helps to select and adjust the optimum machining mode



- Canned cycle for ROBODRILL
- Programming techniques for cycle time reduction and machining quality improvement on ROBODRILL are functionalized
- Useful G-codes such as fast deep drilling cycle, circle milling cycle, deburring cycle, tool change cycle, etc. are ready to use

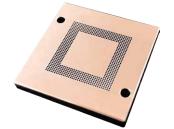

Fast deep drilling example (Φ 0.4mm x 720 holes)




Deburring cycle example

- Level-up of table loading capacity setting
- Easy and exact tuning by automatic setting function
- Finer loading capacity setting in 1kg to achieve optimized acceleration/deceleration



- Fast Cycle-time Technology
 - The latest CNC functions effective for cycle time reduction such as smart overlap function, smart rigid tapping function, etc. are applied
- Other technologies
- · Overlap of the ATC and table motion
- High-speed SKIP interface to reduce measurement time with touch probe
- Tapping spindle with low inertia and high acceleration/deceleration for effective Aluminum machining (option)

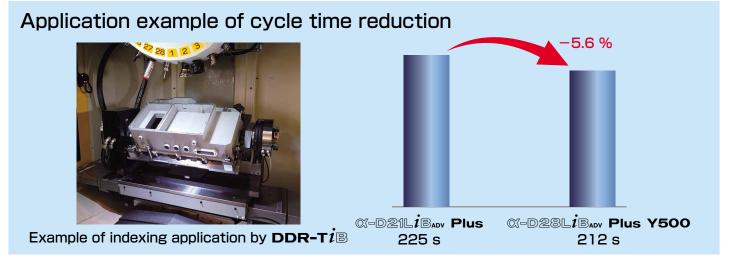

Technology for power saving

- Energy saving setting screen
- Energy saving setting for Robodrill and option devices is available Automatic power off function


Energy saving control of screen saver, illumination, coolant pumps, lubrication, and spindle air purge

Energy saving mode of servo system and rigid tapping*

*Motor output at acceleration/deceleration is limited to reduce consumption.

Cycle time becomes longer relatively

- Sleep function
- Reducing power waste during stand by, by cutting off power supply to servo motors and optional devices
- Mist collector control function (option)
- Energy saving control of mist collector, one of the most power consuming peripherals, can be easily achieved with dedicated interface unit
- Power consumption monitor
- Energy saving effect can be confirmed by the consumption record
- Consumption record can be collected by ROBODRILL-LINK1
- Power regeneration
- Power regeneration function that regenerates the energy at deceleration of motors has been adopted since 1994.
- Regenerated power is used at other equipment and contributes to reduce power consumption of entire factory

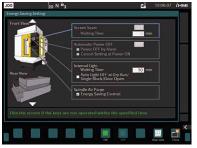


Energy saving setting screen



Power consumption monitor

Network function

- On-board multifunction Ethernet
 - Fast Ethernet port is available for high-speed data transfer. Together with standard Ethernet port, CNC can be connected to two different networks at the same time
 - Various field network protocols such as FL-net, EtherNet/IP, PROFINET, Modbus/TCP are supported
- Field network (option)
- Other field network protocols such as CC-Link, DeviceNet, PROFIBUS-DP are also available by adding option board on CNC
- Network manager screen
- Operability improvement by unifying screens for network settings
- Connection guidance helps to connect PC software such as Program transfer tool or FANUC LADDER III
- · Detailed setting screen supports multiple network connection assignment

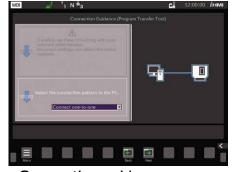

Connection guidance screen



Change allocation screen

High-Performance of Machining

Wide variety of high-speed and high-power spindle

- High-power spindle
- High-rigidity machine structure and optimized combination of spindle unit and spindle motor enables excellent ability in milling in addition to the high-speed drilling and tapping





High power spindle motor

Optimum spindle selectable according to application

Spindle spec.	Max. speed	Application
Standard	10000 min ⁻¹	Wide range of machining use
High-torque		Heavy machining of steel parts (Max. 100N·m)
High- acceleration		High-speed and high-efficiency machining of aluminum parts
Tapping	12000 min ⁻¹	High-cycle light machining of aluminum parts
High-speed	24000 min ⁻¹	High-speed machining with small diameter tools




^{*}Center through coolant spindle (option): Available for all spindle spec. Withstand pressure 7MPa




Center through spindle


Spindle output characteristic

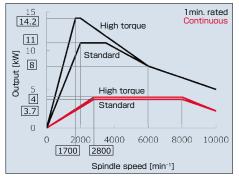

Standard / High-torque

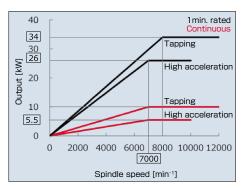


High-acceleration / Tapping

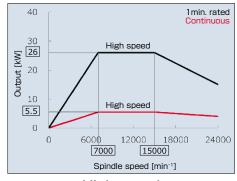


High-speed


Spindle torque characteristic

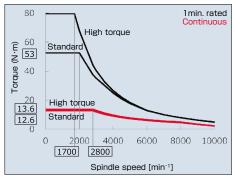

Standard / High-torque

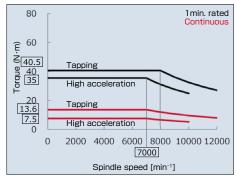

High-acceleration / Tapping

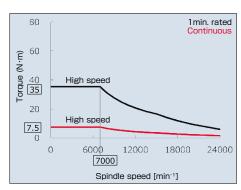

High-speed

^{*}Characteristics of High-torque, High-acceleration, and High-speed spindles are for high-power version


High-precision and fine surface machining

- Fine surface technology
- SERVO HRV⁺ control
 Achieving high-responsiveness by optimized electrical control
- High-precision program command Machining programs with least unit 0.1
 µm are executed exactly
- Smooth tolerance+ control
 Achieving fine surface by smoothing tool path with short line segments and reducing steps between adjacent paths

Further improvement of machining accuracy and surface quality by applying the latest CNC and Servo functions



Example of high precision program command
* Program with least unit 0.1 µm



Example of smooth tolerance⁺ control
* Program with CAM tolerance 5 μm

Stable machining

- Thermal displacement compensation function
- Real time compensation by estimating the thermal displacement based on the operation status of the spindle and feed axes
- By using touch probe (option), compensation effect adjustment can be performed automatically from the measurement result.
- Al thermal displacement compensation function II (Option)
 - Thermal displacement is estimated precisely with the temperature sensors equipped around spindle head and column.
 - Stable compensation against temperature change between day and night or seasons.
 - Even if some of sensors got trouble, sensor check function will keep proper compensation.



Al thermal displacement compensation

Machining Capability


	Machining	Drilling Tool dia.(mm) x Feed(mm/rev)			Tapping Tap size x Tap pitch(mm)		
	Material	S50C	FC200	ADC12	S50C	FC200	ADC12
Spindle spec.	Standard	Dia.30 x 0.10	Dia.30 x 0.25	Dia.32 x 0.35	M20 x 2.5	M27 x 3.0	M30 x 3.5
	High-torque	Dia.30 x 0.15	Dia.30 x 0.30	Dia.32 x 0.40	M20 x 2.5	M27 x 3.0	M30 x 3.5
	Tapping	Dia.25 x 0.15		Dia.32 x 0.30	M18 x 2.5		M27 x 3.0
	High-acceleration	Dia.20 x 0.10		Dia.22 x 0.25	M16 x 2.0		M24 x 3.0
	High-speed	Dia.20 x 0.10		Dia.22 x 0.25	M16 x 2.0		M24 x 3.0

^{*} These data may change by cutting tools or machining conditions.

Maximizing Uptime

High-reliability

- Endeavor to enhance reliability
- · Reliability oriented product development under the slogan of "Reliable, Predictable, Easy to Repair"
- Promoting further improvement of reliability by FANUC's original reliability development method such as accelerated life test
- Reliability evaluation building
- Simultaneous multiple accelerated life tests are carried out in the vast experiment area
- Dedicated test rooms such as anechoic chamber, EMS test room, vibration test room, etc. are utilized for evaluation tests under various conditions
- Abundant track records at FANUC in-house factory
- More than 200 units of ROBODRILLs are working 24 hours at FANUC in-house factory for both steel and aluminum parts machining
- Achieving High-reliability by analyzing the operation and maintenance data and returning to ROBODRILL design

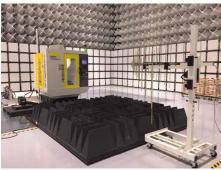


EMC test in anechoic chamber




FANUC in-house factory

ROBODRILL-LINK*i* (PC software)

- Operation condition monitoring system
- Real time display of the entire production area helps to understand the condition of each machine at once
- Supporting improvement of machine utilization by collecting each machine's information and displaying in the graph




- The system can be built with general PC and no server PC is required
- Useful tools for management of ROBODRILLs
- · Collecting ROBODRILL's additional information such as periodical maintenance data, tool life, etc.
- · Making Backup of machining program, parameter, etc.
- NC program can be transferred to multiple ROBODRILLs simultaneously

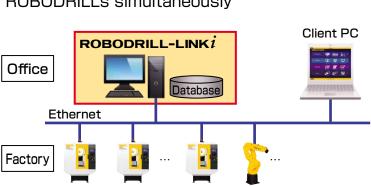

Connection example



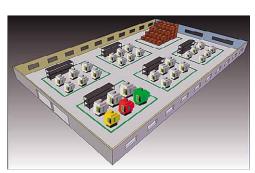

Condition overlook screen



Individual machine operation achievement

Complete preventive maintenance

- Maintenance information management
- · Monitoring the condition of maintenance items and announcing the abnormality or maintenance timing to support effective periodical maintenance
- · Maintenance items can be customized (up to 10)
- Leakage Detection Function
- · Early detection of insulation resistance drop of each motor and motor power cable
- · Enable preventive maintenance before breakdown
- Fan Monitor Function
- Monitoring cooling fans of CNC, Servo Amplifiers, Spindle Amplifier and Power Supply
- · Announcing before failure when the rotation speed of the cooling fans is dropping
- · Easy to detect the abnormal fan



Maintenance information management screen



Fan monitor screen

High-maintainability

- Recovery guidance screens
- · Easy to recover the turret position, motor origin, etc. by following instructions in each screen in case of accident
- Improvement of maintainability for I/O device
- · Cause and point of the failure of I/O devices (disconnection, earth fault etc.) are identified by CNC
- Machine configuration to improve parts replacement
- Cartridge type fan motor units realizes easy parts replacement
- Rechargeable battery unit (option)
 - Supplying backup power both CNC and Pulsecorder
- Automatically recharged while ROBODRILL power ON and battery maintenance free




Motor origin restoration screen



and point

Failure occurs on I/O device

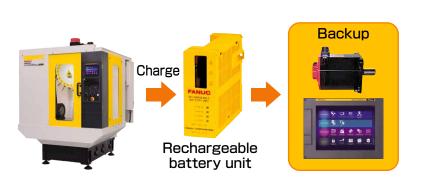



High-usability

- Operator's panel with 10.4" Color LCD for iHMI
 - · Intuitive and operable interface by *î***HMI**
- · Seamless flat display unit with high-resistance to coolant oil
- · Touch panel type display (option) is available
- Supporting PDCA cycle by iHMI CNC operation screen
- A series of works from programming to machining are realized in one screen
- Easy to make program through graphic guidance (*i***HMI** Machining Cycle)
- · Easy to check program by machining simulation with 3D solid model
- Various measurement cycles with touch probe are available (*i***HMI** Set-up Guidance)






*i***HMI** CNC operation screen



*i***HMI** Machining Cycle

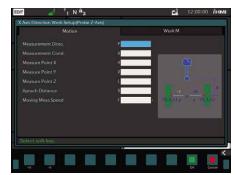

*i***HMI** Set-up Guidance

Automation with Robot

- Robot interface 2 (option)
- System start/stop, operation status check, robot manual operation, etc. are available on screen
- Easy to connect Robodrill and robot by easy setting function
- Safety function and less wires connection by FL-net
- ROBODRILL Robot Package (option)
- Package of basic elements of robot system such as robot, robot base, automatic side door, consolidated connecting cable, Robot interface 2, sample programs of robot, etc.
- Easy to setup robot system as Robodrill and robot are connected at delivery.



operation status screen





Robot manual operation screen



Application Example

High-expandability

- External interface function
- General I/O signals for fixture and peripheral control are ready to use only by assigning in the screen
- · Lighting conditions of signal lamps can be set on the screen
- Custom PMC function
- Ladder program to control peripheral devices can be created without adding any external sequencer unit
- · Custom PMC Ladder can be edited and monitored on screen
- · I/O signals: Input 16 / Output 16 (standard) Input 1024 / Output 1024 (option, maximum)
- Custom PMC for DCS
 - Safety I/O signals of peripherals can be connected (Input 12 / Output 8)
- Software safety circuit can be developed by duplicated signals with Custom PMC function
- Custom control panel
- Control switches (ON/OFF or pulse) and indication lamps can be created on screen without hardware
- · Operability of peripherals can be improved without cost
- Custom screen
- Up to 15 applications developed with FANUC PICTURE (PC software) can be registered
- Usable to control peripheral devices by linking Custom PMC function
- Various exclusive screens for peripheral devices are provided from their suppliers
- Favorite screen
 - · Shortcuts of frequently used screens can be registered



External interface function




Custom control panel




Examples of Custom screen

Conformity of safety standards

- Dual check safety
- Securing operators by duplicating safety I/O signals such as emergency stop and door switch
- Safe torque off (STO) function
- Power between motors and amplifiers are certainly stopped by using safe torque signal

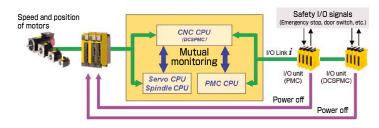


 Conformity of major safety standards (option)

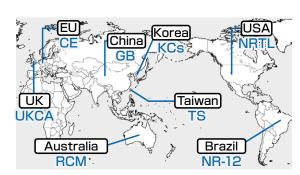

FANUC ROBODRILL DDRIB

- High-speed and high-precision additional 1-axis rotary table **DDR**1 B
- Synchronous built-in servo motor and αiCZ sensor provide non-backlash, high-speed and high-precision machining
- Trunnion unit with DDRi and support spindle for quick setup of indexing fixture **DDR-T**iB
 - · Easy to setup fixture by making the best use of ROBODRILL's working space
- High-speed rotary table for turning DDR-HS1 B
- · Max. speed 1,500min⁻¹ and Max. torque 100N · m
- · High-precision and high-quality turning is available with CNC functions for turninig



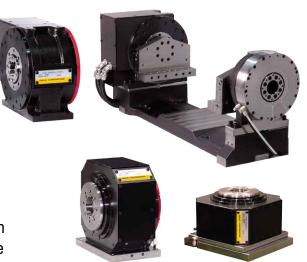

Main options



Coolant unit (tank)



Coolant unit with chip flush (with oil gun)



Cleaning unit for tool taper shank



Top cover



LED Illumination



Tool length switch for automatic measurement



Touch probe





Signal lamp



Automatic Oil Lubricating System



Automatic Grease Lubricating System (LHL Liquid Grease)



Portable manual pulse generator



Rechargeable battery unit

(Note)

· The machine life may be shortened depending on the workpiece, tool, coolant, or lubricant to be used.

Function list

Standard specifications

Control unit FANUC Series 31i-B Plus Simultaneously controlled axes (Max. 4 axes)

Multi-function Ethernet*

Control unit incorporated type display unit with 10.4" color LCD*2

PCMCIA memory card port USB port (USB2.0)

Part program storage size 4Mbyte Number of registerable programs 1000

Addition of workpiece coordinate system 48 pairs

Tool offset pairs 200-pairs Tool life management Production control counter

*i*HMI Set-up Guidance (MANUAL GUIDE *i* on *i*HMI)

Machining Mode Setting

Thermal displacement compensation function

Custom PMC

Dual check safety

Smart Trouble Shooting Function Leakage Detection Function

Backup function for power failure (quick stop function)*3

Smart rigid tapping Spindle Smart Load Meter Al contour control I HRV control

Rapid traverse block overlap Helical interpolation Coordinate system rotation

Tool offset Multi-step skip High-speed skip Custom macro

Interruption type custom macro

Mechanical Option (Note) Some options are not applicable depending on machine model and configurations.

High torque spindle 10,000min⁻¹, High acceleration spindle 10,000min⁻¹ Tapping spindle 12,000min⁻¹, High speed spindle 24,000min⁻¹

Low vibration High speed spindle 24,000min-1

High power version spindle

Double contact tooling (BBT30/NBT30)

Center through spindle (7MPa)

High column (100/200/300/400mm)*4

Splashguard wide opening door *5

Automatic front door opening/closing of splashguard Automatic side door of splashguard (right/left) Splashguard glass window (window size is smaller)

Basic top cover of splashguard/Full-closed cover of splashguard *6

Color specification

X-axis telescopic cover with 3-pieces *7

Z-axis metal cover *

Additional 1 axis rotary table DDRiB/DDR-TiB/DDR-HSiB (C-axis

installation/Horizontal axis installation)

Rotary joint for DDRiB/Tail support (Standard type) Rotary joint for DDRiB/Tail support (High pressure type)

Rotary joint for DDR-HSiB (Hydraulic type)

Adjustment of center height, Adjustment of shaft length,

End plate (for DDRiB)

Coolant unit (Tank capacity: 100/200/140*8 L)

Coolant unit for center through coolant

(Tank capacity: 240/200*8 L, Pressure: 1.5MPa)

Coolant unit with chip flush (with oil gun) Cleaning unit for tool taper shank

Excellent chip evacuation

Air blow for chips

Grip cover

Automatic oil lubricating/Automatic grease lubricating

Illumination (LED) Signal lamp (3 lamps) Tool length switch Touch probe

Electric Option (Note) Some options are not applicable depending on machine model and configurations.

Additional controlled 1 axis (Simultaneously controlled 4 axes) Conformity to safety standards for EU (CE), China (GB), Taiwan (TS), Korea (KCs), UK(UKCA), US(NRTL), Australia (RCM) and

Brasil (NR-12) Automatic breaker shutdown

Backup function for power failure (quick stop funcion)*3 Power cable (length: 5/12/3*9 m)

Mounting plate for options

Various additional I/O unit CNC with touch panel LCD

Network adapter (DeviceNet, PROFIBUS-DP, CC-Link) Fast data server (with Compact Flash Memory 4GB)

ROBOT INTERFACE 2

Portable MPG (with ESP switch)

RS-232C port

Recharegeable battery unit

Software Option (Note) Some options are not applicable depending on machine model and configurations.

Al thermal displacement compensation II

Al tool monitoring

Part program storage size 8Mbyte Number of registerable programs 4000

Addition of workpiece coordinate system 300 pairs

Tool management function (1000 pairs)

3D interference check Single direction positioning Conical/spiral interpolation Involute interpolation Cylindrical interpolation Polar coordinate command

Scaling

Programmable mirror image

Al contour control II High-speed processing

Look-ahead blocks expansion (1000 blocks)

Smooth tolerance + control NURBUS interpolation

Smooth TCP

3-dimensional cutter compensation 3-dimensional coordinate conversion

Punch tapping function Smart spindle load control Quick progtram restart Turning function

PC Software

ROBODRII I -I INK*i* ROBODRILL-CNCGuide **FANUC SERVO VIEWER** FANUC I ADDFR-Ⅲ **FANUC PICTURE** Program transfer tool

- *1 Fast Ethernet is embeded on CNC main board. Available network functions: FL-net, Ethernet/IP, PROFINET IO, Modbus/TCP
- *2 The color LCD screen may have a few missing or constantly lit pixels.
 *3 This function is standard for Advanced version and option for Standard version.
- *4 Max 200mm for X-axis stroke 300mm, Max 300mm for X-axis stroke 500mm and 700mm of Standard version
 *5 Opening width is 730mm for X-axis stroke 500mm and 1100mm for X-axis stroke 700mm. It is standard for X-axis stroke 300mm.
- *6 Mist collector must be used together.
- *7 Only for Standard version
- *8 In case of X-axis stroke 300mm
- *9 In case of the compliance with safety regulation (except for NRTL, RCM and NR-12)

Specification

Item					
Machine (Stan	ndard)	w Bi-re/Bi ids		w bi-eie i ids	
(2.55)	X-axis travel (longitudinal movement of table)	300 mm	500 mm	700 mm	
Capacity	Y-axis travel (cross movement of saddle)		400 mm		
	Z-axis travel (vertical movement of spindle head)				
	Distance from table surface to spindle gage plane				
Table	Working space (X-axis×Y-axis)	630 mm×330 mm	650 mm×400 mm	850 mm×410 mm	
	Capacity of workpiece mass	200 kg (uniform load) 300 kg (uniform load)			
	Working surface configuration	3 x T-slots size 14 mm pitch 125 mm			
Spindle	Speed range	100 min ⁻¹ to 10000 min ⁻¹ 100 min ⁻¹ to 12000 min ⁻¹ / 240 min ⁻¹ to 24000 min ⁻¹ (option)			
	Spindle gauge (Call number) *1	7/24 taper No.30 (with air blow)			
Canduata.	Rapid traverse rate	48 m/min (X, Y, Z)			
Feedrate	Cutting feedrate	1 mm/min to 30000 mm/min			
	Type of tooling / Type of pull stud bolt	JIS B 6339-2 No.30 / MAS 403-1982 P30T-1 (45°) *2			
	Tool storage capacity	21 tools : α -D21S i B Plus / D21M i B Plus / D21L i B Plus 14 tools : α -D14S i B Plus / D14M i B Plus / D14L i B Plus			
	Maximum tool diameter	80 mm			
Turret	Maximum tool length	200 mm (changes by specifications) 250 mm (changes by specifications)			
	Maximum tool mass [Total mass]	2 kg [23 kg] / 3 kg [33 kg] : 21 tools 2 kg [15 kg] / 3 kg [22 kg] : 14 tools			
	Tool changing time (Cut to Cut)	1.6 s (2 kg setting) : 21 tools 1.4 s (2 kg setting) : 14 tools			
Motors	Spindle drive motor	11.0 kW (1minute rating) / 3.7 kW(continuous rating) (changes by specifications)			
Accuracy *3	Bidirectional accuracy of positioning of an axis	0.006 mm to 0.020 mm (IS0230-2:1988)			
Accuracy 3	Bidirectional repeatability of positioning of an axis	Less than 0.004 mm (ISO230-2:1997,2006)			
Sound pressur	re level	Less than 70 dB *4			
Control unit		FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes)			
Installations	(note) Please make sure to comply with	installation conditions specified by FANUC when installing ROBODRILL *5			
Power source	Power supply	200V AC to 220V AC, -15 % to $+10$ %, 3-phase, 50 Hz ± 1 Hz or 60 Hz ± 1 Hz Standard/High-torque/High-torque (High-power version)/High-acceleration/High-speed: 10 kVA, High-acceleration/High-speed (High-power version): 12 kVA, Tapping: 18 kVA *6			
	Compressed air supply	0.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³/min (at atmospheric pressure) *7			
	Machine height	$2236 \text{ mm} \pm 10 \text{ mm}$ (wh	$2236 \text{ mm} \pm 10 \text{ mm}$ (when no high column is specified)		
Machine size	Floor space	995 mm×2210 mm	1615 mm×2040 mm	2165 mm×2040 mm	
	Mass of machine	Approx. 1950 kg	Approx. 2000 kg	Approx. 2100 kg	

^{*1} Spindle gauge does not conform to JIS B 6340:1992, JIS B 6340-1:2019 or JIS B 6340-2:2019.

^{*2} In case of using center through coolant, please apply suitable pull stud bolt for Robodrill of each tooling supplier.

*3 Positioning accuracy is the adjusted and measured value in compliance with applicable standard at FANUC's factory. Depending on an influence of JIG & workpiece mass on table, the use conditions and installation environment, there may be a case where the accuracy shown in this catalog can not be achieved.

^{*4} Sound pressure level is measured in compliance with FANUC's own regulation. Depending on the use conditions and installation environment, there may be a case where the sound pressure level shown in this catalog can not be achieved.


^{*5} Fastening the machine to the floor (mounting anchors) may be required depending on the use conditions and installation environment, or to prevent the machine from toppling over due to an earthquake.


^{*6} When peripherals such as coolant unit or rotary table are added, additional power is required. Please contact FANUC for detail. A cable with 10 mm²~14mm² should be used at primary power connection.

^{*7} In case of center through coolant, additional + 0.05 m³/min is required. In case of air blow for chips, additional + 0.2 m³/min is required. In case of side automatic door, 0.4 MPa compressed air supply or more is required.

C-D14/21SiB Plus

995 995 9661 1380 1080[140L, 200L] [e'>/> - \(\sigma \) / Center through coolant

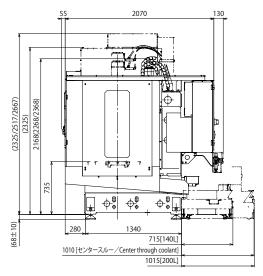


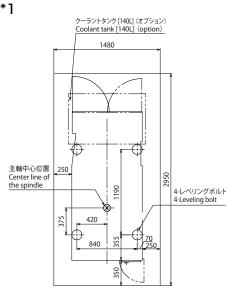



${\it ext{C}}$ -D14/21MiB Plus


*1


*1

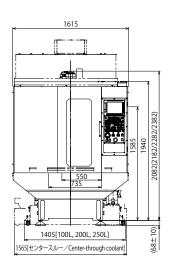

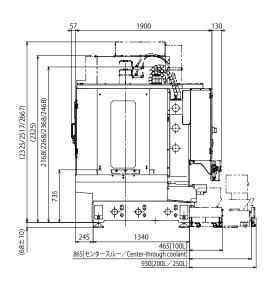

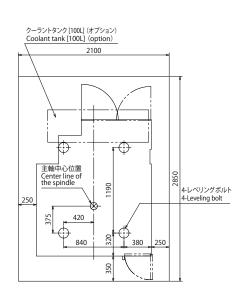

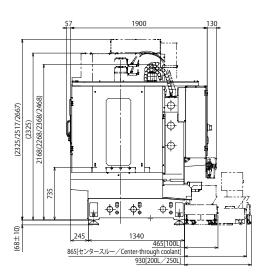

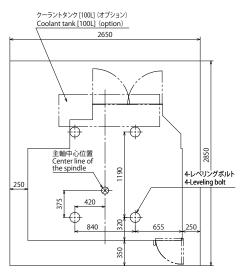

^{*1} These dimensions may change by adding options. (For further details, please contact FANUC.)

Specification

Machine (Standard) Capacity Xexis travel (longitudinal movement of table) 300 mm 500 mm 700 mm 500 mm 500 mm 500 mm 500 mm 700 mm 500 mm 700 mm 500 mm 700 mm 70	ltem		C-D21S1Bady Plus	©-D28M1BADV Plus ©-D21M1BADV Plus	(X-D28L1Bady Plus Y500 (X-D21L1Bady Plus Y500	
Machine (Statuder) Statuder (Interpretation of table) 300 mm 500 mm 700 mm			©-D14S1Badv Plus			
X-axis travel (longiturinal movement of table) 300 mm 500 mm 700 mm 500 m	Machine (Stan	ndard)		WE DE HOUSEADVI 100	OL DI LEPEADVI IGO I COO	
Y-axis travel (cross movement of saddle) 300 mm + 100 mm 400 mm 500 mm 500 mm 100 mm 1	,		300 mm	500 mm	700 mm	
2-ask travel vertical movement of spindle flead 4.00 mm (abunt to bistance from table surface to spindle gase plane 80 mm to 480 mm (when no high column is specified)	Capacity		300 mm + 100 mm	400 mm	500 mm	
Morking space (X-axis XY-axis) 630 mm X 330 mm 650 mm x 400 mm 850 mm x 500 mm		Z-axis travel (vertical movement of spindle head)	400 mm			
Morking space (X-axis XY-axis) 630 mm X 330 mm 650 mm x 400 mm 850 mm x 500 mm		Distance from table surface to spindle gage plane	80 mm to 480 mm (whe	en no high column is spec	ified)	
Table Capacity of workpiece mass 200 kg (uniform load) 400 kg (uniform load)	Table	Working space (X-axis × Y-axis)		T .		
Spindle Speed range		Capacity of workpiece mass	200 kg (uniform load) 400 kg (uniform load)			
Spindle Spindle gauge (Call number) *1 7/24 taper No.30 (with air blow)		Working surface configuration				
Repid traverse rate 54 m/min (X, Y, Z) 54 m/min (X, Y, 60 m/min (Z) 1 mm/min to 30000 mm/min 20 1 mm/min to 30000 mm/min 20 28 tools : α-D28MiBaov Plus / D28LiBaov Plus / D21LiBaov Plus / S00 21 tools : α-D28MiBaov Plus / D28LiBaov Plus / D21LiBaov Plus / S00 14 tools : α-D218JiBaov Plus / D21LiBaov Plus / D21LiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / D14LiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / D14LiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / D14LiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / D14LiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / D14LiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / D14MiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / D14MiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plus / D14MiBaov Plus / S00 14 tools : α-D14SiBaov Plus / D14MiBaov Plu	Spindle	Speed range				
Type of tooling / Type of pull stud bolt JIS B 6339-2 No.30 / MAS 403-1982 P30T-1 (45') *2		Spindle gauge (Call number) *1	7/24 taper No.30 (with air blow)			
Type of tooling / Type of pull stud bolt JIS B 6339-2 No.30 / MAS 403-1982 P30T-1 (45') *2	Foodrata	Rapid traverse rate	54 m/min (X, Y, Z) 54 m/min (X,Y), 60 m/min (Z			
$ \begin{tabular}{l l l l l l l l l l l l l l l l l l l $	reedrate	Cutting feedrate	1 mm/min to 30000 mm/min			
$\begin{tabular}{l l l l l l l l l l l l l l l l l l l $		Type of tooling / Type of pull stud bolt	JIS B 6339-2 No.30 / MAS 403-1982 P30T-1 (45°) *2			
Turret Maximum tool length 200 mm (changes by specifications) 250 mm		Tool storage capacity	21 tools: α -D21S i Badv Plus / D21M i Badv Plus / D21L i Badv Plus Y500			
Turret Maximum tool length 200 mm (changes by specifications) 250 mm		Maximum tool diameter	80 mm			
1.5 kg [24 kg] / 2 kg [30 kg] / 3 kg [38 kg] / 4 kg [46kg] : 28 tools	Turret	Maximum tool length	200 mm (changes by 250 mm			
Tool changing time (1001 to 1001) O.7 s (2 kg setting) / 0.9 s (3 kg setting) / 1.1 s (4 kg setting) : 21/14 tools Tool changing time (Cut to Cut) 1.3 s (1.5 kg setting) / 1.5 s (2 kg setting) / 1.7 s (3 kg setting) : 21/14 tools Notors Spindle drive motor 11.0 kW (1minute rating) / 3.7 kW(continuous rating) (changes by specifications) Bidirectional accuracy of positioning of an axis Bidirectional repeatability of positioning of an axis Bidirectional repeatability of positioning of an axis Bidirectional repeatability of positioning of an axis Control unit FANUC Series 31/-B Plus (Simultaneously controlled axes: Max.4 axes) Installations (note) Please make sure to comply with installation conditions specified by FANUC when installing ROBODRILL *5 Power supply Power supply Power supply 200V AC to 220V AC, -15 % to +10 %, 3-phase, 50 Hz±1 Hz or 60 Hz±1 Hz Standard/High-torque/High-torque (High-power version)/High-acceleration/High-speed: 10kVA, High-acceleration/High-speed (High-power version): 12kVA, Tapping: 18kVA *6 Compressed air supply O.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine size Floor space Pool Changing time (Cut to Cut) 1.3 s (1.5 kg setting) / 1.7 s (3 kg setting) / 1.7 s (4 kg setting) / 1.8 k (4 kg setting) / 1.8 k (4 kg setting) / 1.7 s (4 kg setting) / 1.8 k (4 kg setting) / 1.7 s (4 kg setting) / 1		Maximum tool mass [Total mass]	2 kg [23kg] / 3 kg [33 kg] / 4 kg [46 kg] : 21 tools			
Motors Spindle drive motor 11.0 kW (1minute rating) / 3.7 kW(continuous rating) (changes by specifications) Accuracy *3 Bidirectional accuracy of positioning of an axis Bidirectional repeatability of positioning of an axis Bidirectional accuracy of Bidirectional accuracy of Bidirectional accuracy of Bidirectiona		Tool changing time (Tool to Tool)				
Bidirectional accuracy of positioning of an axis Bidirectional repeatability of positioning of an axis Bidirectional accuracy of positioning of an axis Less than 0.004 mm (IS0230-2:1997,2006) Less than 70 dB *4 Control unit FANUC Series 311-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 311-B Plus (Simultaneously controlled axes: Max.4 axes) 200V AC to 220V AC, -15 % to +10 %, 3-phase, 50 Hz±1 Hz or 60 Hz±1 Hz Standard/High-torque/High-torque (High-power version)/High-acceleration/High-speed: 10kVA, High-acceleration/High-speed (High-power version): 12kVA, Tapping: 18kVA *6 Compressed air supply O.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), O.16 m³ /min (at atmospheric pressure) *7 Machine height Power source Machine height Floor space Positional crude (High-power version) (Bage pressure), D.16 m³ /min (at atmospheric pressure) *7 Machine size Floor space Positional crude (High-power version) (Bage pressure), D.16 m³ /min (at atmospheric pressure) *7 Machine height Power source Bidirectional crude (High-power version) (Bage pressure), D.16 m³ /min (at atmospheric pressure) *7 Machine height Floor space Positional crude (High-power version) (Bage pressure), D.16 m³ /min (at atmospheric pressure) *7 Machine height Power source Bidirectional crude (High-power version) (Bage pressure), D.16 m³ /min (at atmospheric pressure) *7 Machine height Power source Bidirectional crude (High-power version) (Bage pressure), D.16 m³ /min (at atmo		Tool changing time (Cut to Cut)				
Accuracy *3 Bidirectional repeatability of positioning of an axis Sound pressure level Control unit FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) Installations (note) Please make sure to comply with installation conditions specified by FANUC when installing ROBODRILL *5 Power supply Power supply Power supply Compressed air supply Machine height Machine size Bidirectional repeatability of positioning of an axis Less than 0.004 mm (ISO230-2:1997,2006) Less than 70 dB *4 FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 ax	Motors	Spindle drive motor	11.0 kW (1minute rating) / 3.7 kW(continuous rating) (changes by specifications)			
Sound pressure level Control unit FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) Installations (note) Please make sure to comply with installation conditions specified by FANUC when installing ROBODRILL *5 Power supply Power supply Power source Compressed air supply Machine height Machine size Bidirectional repeatability of positioning of an axis Less than 0.004 mm (ISO230-2:1997,2006) Less than 70 dB *4 FANUC Series 31i-B Plus (Simultaneously controlled axes: Max.4 axes) Installations (note) Please make sure to comply with installation conditions specified by FANUC when installing ROBODRILL *5 200V AC to 220V AC, -15 % to +10 %, 3-phase, 50 Hz±1 Hz or 60 Hz±1 Hz Standard/High-torque/High-torque (High-power version)/High-acceleration/High-speed: 10kVA, High-acceleration/High-speed (High-power version): 12kVA, Tapping: 18kVA *6 0.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine height Plus (Simultaneously controlled axes: Max.4 axes) 10kVA, 14x axes) 10kVA, 15 % to +10 %, 3-phase, 50 Hz±1 Hz or 60 Hz±1 Hz Standard/High-torque/High-torque (High-power version)/High-acceleration/High-speed: 10kVA, High-acceleration/High-speed (High-power version): 12kVA, Tapping: 18kVA *6 0.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine height Floor space Floor space Plus (Simultaneously controlled axes: Max.4 axes) 10kXA takes	100 Jracy *3	Bidirectional accuracy of positioning of an axis	itioning of an axis 0.006 mm to 0.020 mm (ISO230-2:1988)			
Power source Power supply Power supply Power supply Power source Compressed air supply Compressed air supply Power source Machine size Power space P	Accuracy 5	Bidirectional repeatability of positioning of an axis	Less than 0.004 mm (IS0230-2:1997,2006)			
Installations (note) Please make sure to comply with installation conditions specified by FANUC when installing ROBODRILL *5 Power supply	Sound pressur	re level				
Power source Power supply 200V AC to 220V AC, -15 % to +10 %, 3-phase, 50 Hz±1 Hz or 60 Hz±1 Hz Standard/High-torque(High-torque (High-power version)/High-acceleration/High-speed: 10kVA, High-acceleration/High-speed (High-power version): 12kVA, Tapping: 18kVA *6 Compressed air supply 0.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine height 2236 mm ± 10 mm (when no high column is specified) Floor space 995 mm×2220 mm 1615 mm×2050 mm 2165 mm×2115 mm			FANUC Series 311-B Plus (Simultaneously controlled axes: Max.4 axes)			
Power supply Standard/High-torque (High-power version)/High-acceleration/High-speed: 10kVA, High-acceleration/High-speed (High-power version): 12kVA, Tapping: 18kVA *6 Compressed air supply O.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine height Power supply O.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine height Ploor space Power supply O.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Ploor space Power supply O.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine height Ploor space Power supply O.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine height Ploor space Power supply O.35 MPa to 0.55 MPa (0.5 MPa is recommend) (gage pressure), 0.16 m³ /min (at atmospheric pressure) *7 Machine height Ploor space	Installations	(note) Please make sure to comply with	installation conditions sp	pecified by FANUC when i	nstalling ROBODRILL *5	
Compressed air supply 0.16 m³ /min (at atmospheric pressure) *7 Machine height 2236 mm ± 10 mm (when no high column is specified) Floor space 995 mm×2220 mm 1615 mm×2050 mm 2165 mm×2115 mm	Power source	Power supply	Standard/High-torque/High-torque (High-power version)/High-acceleration/High-speed:			
Machine size Floor space 995 mm×2220 mm 1615 mm×2050 mm 2165 mm×2115 mm		Compressed air supply	, , , , , , , , , , , , , , , , , , , ,			
Machine size Floor space 995 mm×2220 mm 1615 mm×2050 mm 2165 mm×2115 mm		Machine height	2236 mm ± 10 mm (wh	nen no high column is spe	cified)	
Mass of machine Approx. 2200 kg Approx. 2250 kg Approx. 2450 kg	Machine size	Floor space	995 mm×2220 mm	1615 mm×2050 mm	2165 mm×2115 mm	
		Mass of machine	Approx. 2200 kg	Approx. 2250 kg	Approx. 2450 kg	

^{*1} Spindle gauge does not conform to JIS B 6340:1992, JIS B 6340-1:2019 or JIS B 6340-2:2019.

^{*2} In case of using center through coolant, please apply suitable pull stud bolt for Robodrill of each tooling supplier.

^{*3} Positioning accuracy is the adjusted and measured value in compliance with applicable standard at FANUC's factory. Depending on an influence of JIG & workpiece mass on table, the use conditions and installation environment, there may be a case where the accuracy shown in this catalog can not be achieved.

*4 Sound procesure level in measured in compliance with FANUC's own regulation. Depending on the use conditions and installation environment, there may be a

^{*4} Sound pressure level is measured in compliance with FANUC's own regulation. Depending on the use conditions and installation environment, there may be a case where the sound pressure level shown in this catalog can not be achieved.


^{*5} Fastening the machine to the floor (mounting anchors) may be required depending on the use conditions and installation environment, or to prevent the machine from toppling over due to an earthquake.
*6 When peripherals such as coolant unit or rotary table are added, additional power is required. Please contact FANUC for detail. A cable with 10 mm²~14mm² should be used at primary power connection.


^{*7} In case of center through coolant, additional + 0.05 m³/min is required. In case of air blow for chips, additional + 0.2 m³/min is required. In case of side automatic door, 0.4 MPa compressed air supply or more is required.

$ilde{\mathbb{C}}$ -D14/21S \dot{i} Badv Plus


1586 1080[140L, 200L]


1300

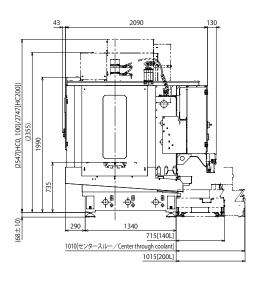


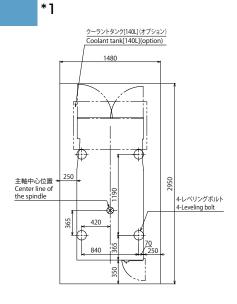

* 1

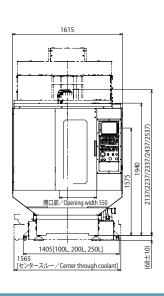


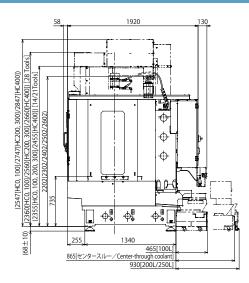


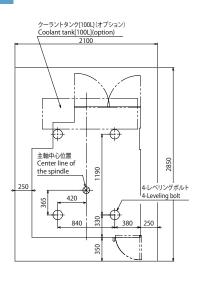


$^{\odot}$ -D14/21/28L \dot{i} Badv Plus Y500

* 1

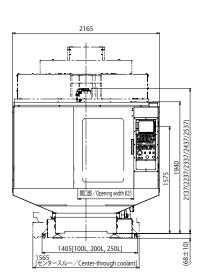

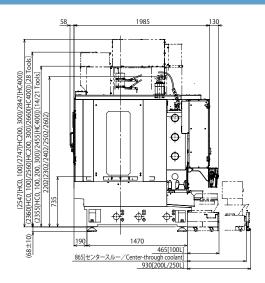

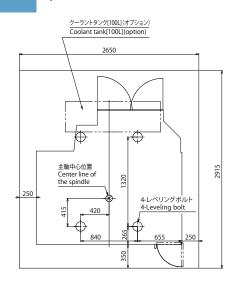

^{*1} These dimensions may change by adding options. (For further details, please contact FANUC.)

Excellent Maintenance Services



FANUC ACADEMY

FANUC ACADEMY operates training programs on FANUC ROBODRILL which focus on practical operations and programming with machining know-how and maintenance.



Lifetime

Maintenance

Lifetime maintenance

FANUC offers lifetime maintenance, where FANUC's products will be serviced as long as they are used by customers.

The motors, PCBs or any units of even over thirty years old can be repaired and recovered.

To perform lifetime maintenance, FANUC stocks enough amount of discontinued spare parts and even redesigns units when spare parts have run out.



TAPE CENTER-MODEL D (1978~1986)



Redesign of CRT display



FANUC Repair factory

Алматы (7273)495-231 Ангарск (3955)60-70-56 Архангельск (8182)63-90-72 Астрахань (8512)99-46-04 Барнаул (3852)73-04-60 Белгород (4722)40-23-64 Благовещенск (4162)22-76-07 Брянск (4832)59-03-52 Владикавказ (8672)28-90-48 Владикавказ (8672)28-90-48 Владикавказ (8672)28-90-48 Волоград (844)278-03-48 Вологра (8172)26-41-59 Воронеж (473)204-51-73 Екатеринбург (343)384-55-89 Иваново (4932)77-34-06 Ижевск (3412)26-03-58 Иркутск (395)279-98-46 Казань (843)206-01-48 Калининград (4012)72-03-81 Камуга (4842)92-23-67 Кемерово (3842)65-04-62 Киров (6332)68-02-04 Коломна (4946)23-41-49 Кострома (4942)77-07-48 Краснодар (861)203-40-90 Красноярск (391)204-63-61 Курск (4712)77-13-04 Курган (3522)50-90-47 Липецк (4742)52-20-81

Россия +7(495)268-04-70

Москва (495)268-04-70 Мурманск (8152)59-64-93 Набережные Челны (8552)20-53-41 Нижний Новгород (831)429-08-12 Ноябрьск (3496)41-32-12 Новосибирск (383)227-86-73 Омск (3812)21-46-40 Орел (4862)44-53-42 Оренбург (3532)37-68-04 Пенза (8412)22-31-16 Петрозаводск (8142)55-98-37 Псков (8112)59-10-37 Пермь (342)205-81-47 Казахстан +7(7172)727-132

Пагнитогорск (3519)55-03-13

Ростов-на-Дону (863)308-18-15 Рязань (4912)46-61-64 Самара (846)206-03-16 Санкт-Петербург (812)309-46-40 Саратов (845)249-38-78 Севастополь (8692)22-31-93 Саранск (8342)22-96-24 Симферополь (3652)67-13-56 Смоленск (4812)29-41-54 Сочи (862)225-72-31 Ставрополь (8652)20-65-13 Сургут (3462)77-98-35 Сыктывкар (8212)25-95-17 Тамбов (4752)50-40-97 Тверь (4822)63-31-35 Киргизия +996(312)96-26-47 Тольятти (8482)63-91-07 Томск (3822)98-41-53 Тула (4872)33-79-87 Тюмень (3452)66-21-18 Ульяновск (8422)24-23-59 Улан-Удэ (3012)59-97-51 Уфа (347)229-48-12 Хабаровск (4212)92-98-04 Чебоксары (8352)28-53-07 Челябинск (351)202-03-61 Череповец (8202)49-02-64 Чита (3022)38-34-83 Якутск (4112)23-90-97 Ярославль (4852)69-52-93